


**BOSCH**

Invented for life

## Installation guide of rubber gasket for FLEXIDOME Wall Mount

Applicable to: Outdoor installation of VDA-WMT-DOME - FLEXIDOME Wall Mount

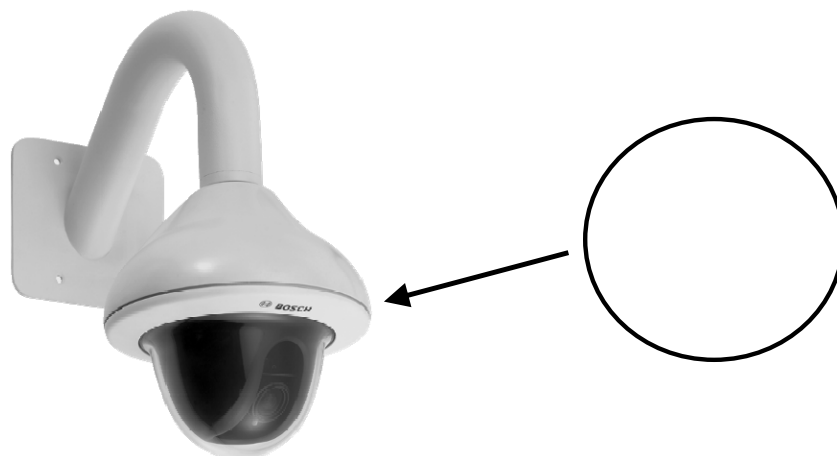

In certain installations in humid environments, moisture can enter the FLEXIDOME Wall Mount. This causes condensation on the inside of the camera's bubble. To prevent this, a rubber gasket\* is added to the VDA-WMT-DOME - FLEXIDOME Wall Mount. It is recommended to use this rubber gasket in certain outdoor installations or installations in humid environments.

The installer has to place the rubber gasket between the FLEXIDOME ring and the wall mount hood. This document serves as a quick installation guide.

There is no need to add the gasket to existing installations. But in case of customer complaints, spare rubber gaskets can be requested via Product Management.

\*All VDA-WMT- DOME ordered after feb-2014 come with the rubber gasket in the product package.

### 1. Install dome according instructions

Install the dome on the dome mount without using the rubber gasket



## 2. Loosen the dome screws

Ensure sufficient space to fit the rubber gasket in the groove between dome and dome mount by loosening the dome screws



## 3. Place rubber gasket onto dome mount

Stretch the rubber gasket to fit over the dome mount above the groove. In existing installations the groove must be cleaned first.

Warning: Do not overstretch the gasket.



## 4. Move rubber gasket in groove

Roll the rubber gasket down to fit into the groove. Check if gasket fits inside groove on all sides



## 5. Tighten the dome screws

Finalize installation by tightening the dome screws

